| | | | | | | | | | | | | | | | | Ra | ilroad Accidents | in Eureka C | ounty, 197 | 5-2005 | | | |
|----|-------------------------------|---------|--------------|---------|-------|------|----------------|------------------------|----------|----|--------------------|------|------------------------------|----------------------|--------------|---------------|--------------------------------|---------------|-----------------------------|--------------|--|---|---|
| | Report | Ma Davi | Ti | me Y | ear / | ST | 0 | Туре | | | ype Primar | | Equipment | Track | Fatalitia | la i a a i | DD Savia | | ocomotives | Cars | Hazmats | Milepost, Location | Cause of Accident: Description |
| UP | 57911 274577 | 8 22 | 2:0 | 5 PM 19 | | | County | Main Industr | UP | | er E32C | E33C | Damage 5,000 | Damage 1,297 | Fatalities 0 | Injuries 0 | RR Equip FREIGHT TRAIN | Mph 50 | Derailed 0 | Derailed | 1 car carrying hazmats, not 0 damaged or derailed, no release | 520.1 near Barth | Coupler drawhead broken or defective andcoupler retainer pin/cross key missing: Derailment |
| UP | 50407 52157 | 8 27 | 12:10 | PM 19 | 76 N | IV E | UREKA | Main | UP | Ot | th E62C | | 550 | 6,000 | 0 | 0 | FREIGHT TRAIN | 50 | 0 | | 2 | 510 near Beowawe | broken plate |
| | 55216 | | 11:45 | AM 19 | 76 N | IV E | UREKA | Yard | UP | De | er H702 | | 5,100 | 960 | 0 | 0 | CUT OF CARS | 2 | 0 | | 2 | 508 near Beowawe | Switch improperly lined |
| UP | 0484UT2 05 | | 5:30 | PM 19 | 77 N | IV E | UREKA | Industr | y UP | De | er T108 | | 16,000 | 1,780 | 0 | 0 | FREIGHT TRAIN | 5 | 0 | | 2 | 520.3 near Barth | track alignment irregular: Derailment |
| UP | 44028 292777 | 7 27 | 4:15 | PM 19 | 77 N | IV E | UREKA | Main Industr | UP Ty | De | er E53C | | 2,000 | 31,074 | 0 | 0 | FREIGHT TRAIN | 50 | 0 | | 1 car carrying 1 hazmat derailed but no release | 610.12 near Dunphy | Journal (roller bearing) overheating |
| | Q3162 | 8 19 | 3:15 | PM 19 | 77 N | IV E | UREKA | Siding | | De | er T108 | | 50 | 3,100 | 0 | 0 | LIGHT LOCO(S) | 5 | 5 | | 0 | 508.4 near Beowawe | Trk alignmnt irreg-not buckled/sunkink |
| UP | 48888 68220 | 9 3 | 12:15 | PM 19 | 77 N | IV E | UREKA | Main | UP | De | er E53C | | 1,200 | 17,145 | 0 | 0 | FREIGHT TRAIN | 50 | 0 | , | 1 | 612.8 near Beowawe | Journal (roller bearing) overheating |
| | Q0084 1100UT0 | | 6:35 | | 78 N | | UREKA | | UP | | er E07C | | 350 | | 0 | | FREIGHT TRAIN | 50 | 0 | | 1 | 511 near Beowawe | Rigging down or dragging Side bearing(s) missing |
| _ | 02 50417 | | 8:00 8:50 | | | | UREKA UREKA | Main Main | UP | | er E43C er E46C | | 500 3,300 | 7,000 3,600 | 0 | | FREIGHT TRAIN FREIGHT TRAIN | 53 | 0 | | 2 | 524.5 near Palisade 512.1 near Beowawe | Truck bolster stiff |
| | 44169 R5609 | | 9:55 | | | | UREKA | Main Industr | UP | | er H604 | | 19,000 | | 0 | | FREIGHT TRAIN | 55 | 0 | | 5 | 618 west Beowawe | train outside yard limits, in block signal or interlocking territory, excessive speed |
| UP | 282476 | 10 24 | 10:20 | PM 19 | 79 N | IV E | UREKA | Industr | | De | er H702 | | 200 | 16,000 | 0 | 0 | FREIGHT TRAIN | 3 | 2 | | 2 | 507.9 near Beowawe | switch improperly lined |
| UP | 60300 | 6 9 | 2:40 | PM 19 | 80 N | IV E | UREKA | Siding | UP | De | er T109 | H513 | 841,600 | 63,850 | 0 | 0 | FREIGHT TRAIN | 30 | 0 | 2 | 6 | 629.2 near Barth | Track alignment irreg(buckled/sunkink) |
| ПР | 54574 48539 283176 | 10 7 | 9:50 | | | IV E | UREKA | Main Siding Yard | UP | De | er T110 | | 750 | 2,832 | 0 | 0 | FREIGHT TRAIN | 3 | 0 | | 4 | 536 near Palisade | failure to properly cut-out brake valves on locomotives Wide gage(defective/missing crossties) wide gage (due to defective or missing crossties) |
| JP | 2101380 | 10 7 | 7:25 | PM 19 | 80 N | IV E | UREKA | Main | UP | De | er E60C | E68C | 4,000 | 77,500 | 0 | 0 | FREIGHT TRAIN | 45 | 0 | | 2 cars carrying hazmats, neither 1 damaged or derailed, no release | 518.2 near Harney | Broken flange |
| ПD | 54859 | 7 22 | 11:50 | AM 19 | R1 N | IV E | UREKA | Siding | UP | De | er T399 | | 14,000 | 12,220 | 0 | 0 | YARD/ SWITCHIN | G A | 2 | | 5 | 525 near Palisade | Oth frog, switch, trk appliance defect |
| | 50409 | | | | | | | | | | er T199 | | 2,150 | | 0 | | FREIGHT TRAIN | 3 | 2 | | 0 | 508.2 near Beowawe | Other track geometry defects |
| UP | | 7 | | 19 | 83 N | IV E | UREKA | Main | UP | | | | | | 1 | 3 | FREIGHT TRAIN | | | | | Palisade Canyon | Trespass vehicle struck by freight train. 1 casuality, 3 injuries, no reported damage to train |
| JP | Q0022 51597 0696LA0 | | 7:00 | PM 19 | 84 N | IV E | UREKA | Main | UP | De | er H513 | H503 | 15,000 | 961 | 0 | 0 | FREIGHT TRAIN | 13 | 0 | | 1 | 521 near Barth | E3519W,WPV-9,derailedUPFE 457560, blankets, and damaged following car UPFE 459487, meat |
| UP | 07 | | 11:57 | ' AM 19 | 84 N | IV E | UREKA | Industr Main | UP | De | er T401 | T002 | 828,000 | 470,000 | 0 | 0 | FREIGHT TRAIN | 40 | 2 | 3 | 0 | 611 near Dunphy | Bridge collapsed, high water had eroded away part of river embankment weakening bridge support struc 11RVOGP SP 9271 derailed 30 cars at Bridge 610.96 over Humboldt River due to soft track 31 feet wes |
| UP | 241479 | 1 18 | 2:50 | PM 19 | 89 N | IV E | UREKA | | UP | Ot | th E06C | | 29,000 | 779 | 0 | 0 | FREIGHT TRAIN | 50 | 0 | 1 | 0 | 610.1 near Dunphy | Brake valve malf. (stuck brake, etc.): SSW 87101 carload of lumber caught fire while traveling east on UF track. Car completely engulfed in flame, car was subsequently set out on short siding (UP spur) at Dunph and lading burined up completely |
| | | | | | | | | | | | | | | | | | | | | | 2 cars carrying hazmat, neither damaged or | | Other mechanical/electrical fail(locomotive): end emitting carbon and sparks after being put on line, leavi Renner top of car on fire, set out on short spur and burned to ground |
| UP | 262980 0584UT2 | | 5:25 | AM 19 | 89 N | IV E | UREKA | Main | UP | Ot | th E99L | | 35,000 | 0 | 0 | 0 | FREIGHT TRAIN | 55 | 0 | | 0 derailed | 627.1 near Cluro | Highway user inattentiveness: Truck crossed in front of train, train hit truck trailor and pushed it into bridg |
| | 05 | 1 31 | 9:09 | | 92 N | IV E | UREKA | | UP | Ot | h M302 | | 15,000 | 5,000 | 0 | 0 | FREIGHT TRAIN | 45 | 0 | | 0 | 520.3 near Barth | |
| UP | 53704 1192FR0 11 | 11 30 | 3:45 | AM 19 | 92 N | IV E | UREKA | Industr Main | UP | De | er E67C | | 4,000 | 14,966 | 0 | 0 | FREIGHT TRAIN | 35 | 0 | | 1 | 610.5 near Dunphy | Damaged flange or tread (build up): CR 886125 had built up tread on wheels sets1, 3, AND 4, derailed milepost 604.8. Train went into emergency |
| JP | 53216 | 7 21 | | 19 | 94 N | IV E | UREKA | Main | UP | De | er T207 | | 7,000 | 13,200 | 0 | 0 | FREIGHT TRAIN | 45 | 0 | | 1 | 525.7 near Palisade | Detail fracture - shelling/head check: rail with two defects 17 inches apart broke under rear of train and c rearmost car. |
| | 0189NV2 | | | | | | | | | | | | | | | | | | | | | | Tractor trailor loaded with poles was moving over private crossing when truck become highcentered on or Driver was attempting to raise truck when struck by the MINPV-19 eastbound. |
| | 01 | 6 20 | | AM 19 | | | | | UP | | th M399 | | 85,000 | | 0 | | FREIGHT TRAIN | 58 | 0 | | 0 | 610.3 near Dunphy | Journal (raller beggins) guarheating: Durnay off journal, and 4th and from head and CANIN 550445 |
| То | 57871 otal Acci ureka C | | 1 | OTAL A | CCID | ENTS | S/INCIE | ENTS: | | De | er E53C | | 1,500 Equipment Damage | 184,886 Track damage | Fatalities | 0 Injuries | FREIGHT TRAIN | | 0 ocomotives derailed | Cars deraile | Cars carrying hazmats involved | 511.4 near Beowawe | Journal (roller bearing) overheating: Burned off journal on 4th car from head end, CMHX 550415 |
| | 26 | | | , L | | RTIO | | .0, LLI | | | | | \$ 1,935,250 | \$ 954.449 | 1 | 5 | | | 13 | 89 | 6 | | |
| | _0 | | | | | | | | | | | | ,000,200 | + 55-,75 | • | | | | | 1 33 | _ | | |